

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 0369 Libby McNeil

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Left	0.78	03/21/2018 03/21/2018	Keith Millard

LM Start		Rating **	M	Issue No.	22
LM End		Issue Type +	Ma	Location *	
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Flood Preparedness & Training				
DWR ID	DWR_RD0369_01_f_2012_22				
Comment Code					
Inspector Comment					
RD 369 members have not been flood fight trained.					

No Photos

LM Start		Rating **	A	Issue No.	27
LM End		Issue Type +	Ma	Location *	
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Operations & Maintenance Manuals				
DWR ID	DWR_RD0369_01_f_2014_27				
Comment Code					
Inspector Comment					
RD 369 I have forwarded to the District Mr. Clarence Chu a copy of the O & M Manual for their record.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 0369 Libby McNeil

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Left	0.78	03/21/2018 03/21/2018	Keith Millard

LM Start		Rating **	M	Issue No.	28
LM End		Issue Type +	Ma	Location *	
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Emergency Supplies & Equipment			°	°
			°		°
DWR ID	DWR_RD0369_01_f_2014_28				
Comment Code					
Inspector Comment					
RD 369 have no emergency supplies on hand.					

No Photos

LM Start	0.15	Rating **	M	Issue No.	12
LM End	0.15	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		38.257380 °	38.257380 °	
			-121.515787 °	-121.515787 °	
DWR ID	DWR_RD0369_01_s_2018_12				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Cut tree branches should be removed from waterside shoulder.					

Photo 1 of 1 : SP_2018_RD0369_207_12_20180322_00025.jpg



Remove tree branches from waterside shoulder.

LM Start	0.25	Rating **	M	Issue No.	9
LM End	0.57	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.256372 °	38.252597 °	
			-121.514504 °	-121.511130 °	
DWR ID	DWR_RD0369_01_s_2017_9				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Spray the weed growth along the waterside slope to 20' from crown.					

Photo 1 of 1 : SP_2018_RD0369_207_9_20180305_00003.jpg



Looking downstream from the waterside shoulder.

*** Location**

LS : Land Side N/A : Not Applicable
WS : Water Side
CR : Crown

**** Rating**

A : Acceptable N : Not Inspected/Rated
M : Minimally Acceptable C : Corrected
U : Unacceptable A/W : Acceptable but Monitor & Maintain

+ Issue Type

Ma : Maintenance Deficiency
Ob : Design & System Obsolescence
En : Enforcement

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 0369 Libby McNeil

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Left	0.78	03/21/2018 03/21/2018	Keith Millard

LM Start	0.26	Rating **	A/W	Issue No.	13
LM End	0.32	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.256222 °	38.255659 °
				-121.514320 °	-121.513706 °
DWR ID	DWR_RD0369_01_f_2016_13				
Comment Code					
T2 : Thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					
Thin out the tree growth along the landside slope.					

Photo 1 of 1 : SP_2018_RD0369_207_13_20180305_00006.jpg



10/03/2017: Vines and low branches and heavy weed growth have been removed. Visibility and access are improved.

LM Start	0.53	Rating **	C	Issue No.	16
LM End	0.53	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.253095 °	38.253095 °
				-121.511387 °	-121.511387 °
DWR ID	DWR_RD0369_01_s_2016_16				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Cut up and remove the dead tree from the waterside slope. This tree was reported during spring inspection 2016.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 0369 Libby McNeil

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Left	0.78	03/21/2018 03/21/2018	Keith Millard

LM Start	0.54	Rating **	M	Issue No.	10
LM End	0.54	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.252985 °	38.252985 °
				-121.511346 °	-121.511346 °
DWR ID	DWR_RD0369_01_s_2018_10				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Remove cut tree limb from waterside shoulder.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---